

Report of Thorough Examination of Lifting Equipment to LOLER Regulations

Lifting Operations & Lifting Equipment Regulations 1998 number 2307 regulation 9

CERTIFICATE

Date: 03/10/2019

Report Date: 03/10/2019

Report Number: Q3098 V138 006 2044567

Date of examination 02/10/2019

Name and Address Of Owner	DP World Southampton Western Docks Southampton SO15 1DA United Kingdom
--------------------------------------	--

Site Address / Location	DP World Southampton
--------------------------------	----------------------

Description of equipment	Straddle Carrier
Manufacture	Kalmar
Date of Manufacture	2016
Plant No	5352
SWL	40t/50t

Date of last examination	10/04/2019
---------------------------------	------------

Date of next examination	02/04/2020
---------------------------------	------------

- a) Identification of any part found to have a defect which is or could become a danger to a persons, stating description of defect, any repair, renewal or alteration required to remedy the defect, either immediately or within a specified time
- b) Identification of other defect(s)
- c) Any other observation(s)

Included will be particulars of any testing / test

Where a defect involves an existing or imminent risk of personal injury a copy will be sent to the local enforcing agency

- a. None
- b. None
- c. Rear bumpers have signs of impact damage. Recommend: Monitor and rectify when necessary.
3 x Mud guards damaged / missing. Recommend: Monitor and rectify when necessary.
Front and rear spreader guides have signs of wear. Recommend: Monitor and rectify when necessary.
Cab window wash bottle depleted. Recommend: Monitor and rectify when necessary.
Left hand ground level "E" stop has no decal plate. Recommend: rectify.
Left hand leg tie excessive oil causing a potential slip hazard. Recommend: Investigate and rectify.
Excess oil in engine housing. Recommend: Investigate and rectify.
Engine coolant tank has 1 x loose fitting which is leaking. Recommend: rectify.
Left hand rear spreader sheave has signs of minor rope imprint. Recommend: Monitor and rectify when necessary.

Please Note

The ropes were found to be of good condition with no deformations or wire breaks.

Ropes measured at time of inspection using calibrated vernier VPES10DC.

Left Front – 21.50mm

Left Rear- 22.00mm

Right Front – 21.50mm

Right Rear – 22.00mm

I declare that upon the 02 / 10 / 2019 the equipment described in this report was thoroughly examined (unless otherwise stated) in accordance with the lifting operations and lifting Equipment Regulations 1998 SI 2307 and is found safe to use subject to the remedial action to the defects noted upon this report, which are or could become a danger to persons.

Dave Chisholm



Reviewed by:



Martin Pownall

Port Engineering Services
18 Witney Way
Boldon Business Park
Boldon Colliery
NE359PE