

Report of Thorough Examination of Lifting Equipment to LOLER Regulations

Lifting Operations & Lifting Equipment Regulations 1998 number 2307 regulation 9

CERTIFICATE

Date: 06/06/2019

Report Date: 06/06/2019

Report Number: Q3098 V65 005 1965428

Date of examination 06/06/2019

Name and Address Of Owner	DP World Southampton Western Docks Southampton SO15 1DA United Kingdom
--------------------------------------	--

Site Address / Location	DP World Southampton
--------------------------------	----------------------

Description of equipment	Straddle Carrier
Manufacture	Noell
Date of Manufacture	2007
Plant No	17080600-09
SWL	40t

Date of last examination	11/12/2018
---------------------------------	------------

Date of next examination	06/12/2019
---------------------------------	------------

- a) Identification of any part found to have a defect which is or could become a danger to a persons, stating description of defect, any repair, renewal or alteration required to remedy the defect, either immediately or within a specified time
 - b) Identification of other defect(s)
 - c) Any other observation(s)
- Included will be particulars of any testing / test
- Where a defect involves an existing or imminent risk of personal injury a copy will be sent to the local enforcing agency

- a. None
- b. Engine platform header hydraulic tank is depleted. Rectify within 1 month. Work order reference: 1992910
Both hoist barrel oil levels are depleted. Rectify within 1 month. Work order reference: 1992910
Left-hand maintenance ladders step structure is deteriorated. Rectify within 1 month. Work order reference: 1992913
- c. The spreader junction box door is held shut with tie wraps. Recommend: Rectify
There is 1 loose bolt on the right-hand rear idler hub support bracket. Recommend: Rectify
There are loose bolts on the right-hand rear buffer and the buffer structure is dented. Recommend: Rectify
The right-hand rear spreader guide secondary fixing is not connected. Recommend: Rectify
2 x Rear drive lights, 2 x top brake lights, left-hand front headlight, top front flashing beacon all not working. Recommend: Rectify
The cab window wash bottle is missing. Recommend: Replenish wash bottle
2 x Cab sunscreens are missing. Recommend: Rectify

Please note

Exhaust is located near to pipes.

Ropes measured at time of inspection using calibrated vernier VPES10DC

Front Left – 24.00mm

Front Right – 23.50mm

Rear Left – 24.00mm

Rear Right – 24.00mm

I declare that upon the 06 / 06 / 2019 the equipment described in this report was thoroughly examined (unless otherwise stated) in accordance with the lifting operations and lifting Equipment Regulations 1998 SI 2307 and is found safe to use subject to the remedial action to the defects noted upon this report, which are or could become a danger to persons.

George Sizeland / Dave Chisholm



Reviewed by:



Martin Pownall

Port Engineering Services
18 Witney Way
Boldon Business Park
Boldon Colliery
NE35 9PE